

CHANGE IN
BULLETIN 138, ISSUE 5
ADJUSTMENTS - TYPE BAR PAGE PRINTER
(MODEL 15)
AND
BULLETIN 160, ISSUE 1
ADJUSTMENTS - TYPE BAR PAGE PRINTER
(MODEL 20)

Bulletin 138, Page 5 (Figures 6 and 7)
Bulletin 160, Page 3 (Figures 5 and 6)

RIBBON FEED SHAFT BEARING PLATES ADJUSTMENT

Change the first sentence of this adjustment to read as follows:

"The left end of the ribbon feed shaft should be flush with or extend not more than .015" over the inner end of the left vertical feed shaft bevel gear teeth, when the ribbon feed shaft is in its left position and the left vertical feed shaft bevel gear is held in engagement with the ribbon shaft gear."

Add the following note after the adjustment:

NOTE: Check the lateral movement of the ribbon feed shaft (movement from one detented position to the other); it should measure at least 3/16". If necessary, refine the ribbon feed shaft bearing plates adjustment.

* * * * *